

## SERVICE BULLETIN

**APPLICABILITY** LEGACY, IMPREZA AND SVX EQUIPPED  
WITH ABS BRAKES

**DATE** 06-11-96

**SUBJECT** ABS RELAY STICKING

Should you encounter the following condition(s) please follow the trouble shooting chart below:

- The ABS Hydraulic Unit Motor continues to run and/or buzz when the ignition key is turned to the off position.
- The ABS warning light comes on and a trouble code "52" for a faulty hydraulic motor and/or motor relay is stored in memory.

**Note:** It is possible for this condition to occur intermittently. Under these conditions the symptoms may not always be duplicated.

Troubleshooting Steps:

1. Check if the ABS Hydraulic Unit Motor is running or if you can duplicate the condition.
2. If the Hydraulic Unit Motor is running, does it continue to run with the key in the off position?
3. Confirm the trouble code, if any, and trouble shoot according to the Diagnostic Chart in the corresponding Service Manual.
4. Replace the ABS Hydraulic Unit Motor Relay with a modified one. The new part number is 26735AA012. The new relay can be identified by a white line under the word Japan on the relay case.

**Note:** Always check the part number supersession for any changes.

5. If the wiring harness is at fault repair and/or replace as necessary.

The new ABS Motor Relay has been changed in production beginning with the following VIN's.

Legacy (SIA built): Sedan: T\*206647  
S/W: T\*308128  
O/B: T\*374098

SVX: T\*100004

Impreza: Sedan: T\*510065  
S/W: T\*810189  
Coupe: T\*410116

### CAUTION

VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

